

F.IIi Giacomello s.n.c.

TP/TPS

PLASTIC PLUGS
PLASTIC PLUGS WITH BREATHER








PLASTIC PLUGS WITH BREATHER


- Identical for functionality to the serious TM, carried out entirely in tecnopolimero with glass. Resistant to solvents, oils and other chemical agents.
- Estate guaranteed by a level washer in rubberizing synthetic NBR
- They come normally furnished without any label
- Highest temperature of exercise in continue: 130 °C



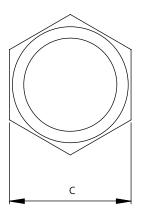

GAS TYPE	TIGHTENING TOROUE -Nm	F	С	Н	L			
TP 1/8" GAS	4	1/8" GAS	19	9	16			
TP 1/4" GAS	4	1/4" GAS	19	9	16			
TP 3/8" GAS	8	3/8" GAS	22	9	16			
TP 1/2" GAS	8	1/2" GAS	26	11	18			
TP 3/4" GAS	10	3/4" GAS	32	12	20			
TP 1" GAS	12	1" GAS	38	13	22			
TP 1"1/4 GAS	16	1"1/4 GAS	46	14	24			
TP 1"1/2 GAS	16	1"1/2 GAS	55	15	26			
METRIC TYPE	TIGHTENING TOROUE -Nm	F	C	Н	اد			
TP - M 10x1,5	4	M 10x1,5	19	9	16			
TP - M 12x1,5	6	M 12x1,5	19	9	16			
TP - M 14x1,5	6	M 14x1,5	19	9	16			
TP - M 16x1,5	8	M 16x1,5	22	9	16			
TP - M 18x1,5	8	M 18x1,5	26	11	18			
TP - M 20x1,5	8	M 20x1,5	26	11	18			
TP - M 22x1,5	10	M 22x1,5	32	12	20			
TP - M 25x1,5	10	M 25x1,5	32	12	20			
TP - M 26x1,5	10	M 26x1,5	32	12	20			
TP - M 35x1,5	16	M 35x1,5	38	13	22			

- Identical for functionality to the serious TMS, carried out entirely in tecnopolimero with glass. Resistant to solvents, oils and other chemical agents.

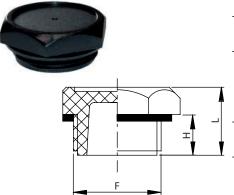

- Estate guaranteed by a level washer in rubberizing synthetic NBR
- In the TPS range, the breather consists of a 2mm hole (which maintains the atmospheric pressure inside the tank).
- They come normally furnished without any label
- Highest temperature of exercise in continue: 130 °C

GAS TYPE	TIGHTENING TOROUE -Nm	F	С	Н	L			
TOROGE IVIII								
TPS 1/8" GAS	4	1/8" GAS	19	9	16			
TPS 1/4" GAS	4	1/4" GAS	19	9	16			
TPS 3/8" GAS	8	3/8" GAS	22	9	16			
TPS 1/2" GAS	8	1/2" GAS	26	11	18			
TPS 3/4" GAS	10	3/4" GAS	32	12	20			
TPS 1" GAS	12	1" GAS	38	13	22			
TPS 1"1/4 GAS	16	1"1/4 GAS	46	14	24			
TPS 1"1/2 GAS	16	1"1/2 GAS	55	15	26			
METRIC TYPE	TIGHTENING TORQUE -Nm	F	С	Н	L			
TPS - M 10x1,5	4	M 10x1,5	19	9	16			
TPS - M 12x1,5	6	M 12x1,5	19	9	16			
TPS - M 14x1,5	6	M 14x1,5	19	9	16			
TPS - M 16x1,5	8	M 16x1,5	22	9	16			
TPS - M 18x1,5	8	M 18x1,5	26	11	18			
TPS - M 20x1,5	8	M 20x1,5	26	11	18			
TPS - M 22x1,5	10	M 22x1,5	32	12	20			
TPS - M 25x1,5	10	M 25x1,5	32	12	20			
TPS - M 26x1,5	10	M 26x1,5	32	12	20			
TPS - M 35x1,5	16	M 35x1,5	38	13	22			
TPS - M 40x1,5	16	M 40x1,5	46	14	24			